

# Manhole Inspection Summary

Manhole # S47I\_\_050MH

Printed On: 2/12/2009

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **471** Node: **050** Status: **Found**

Insp Date: **4/22/08 10:52 AM**

Incomplete Comments

Crew: **dd**  
Inspector: **jjoiner**  
Firm: **ATS**

**Location** Address: **2234 eastern ave** Cross Street: **s patterson park**

**Manhole** Type: **Junction** Location: **Alley** Ground Conditions: **Dry**  
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **aaa**

**Cover** Shape: **Circular** Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **6** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **24** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **5** Missing: **0** ☒ **Corroded**

**Surcharge** ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Location View



Top View



Defect 3




Chimney cracked  
frame adjustment

Defect 2



steps

Defect 1

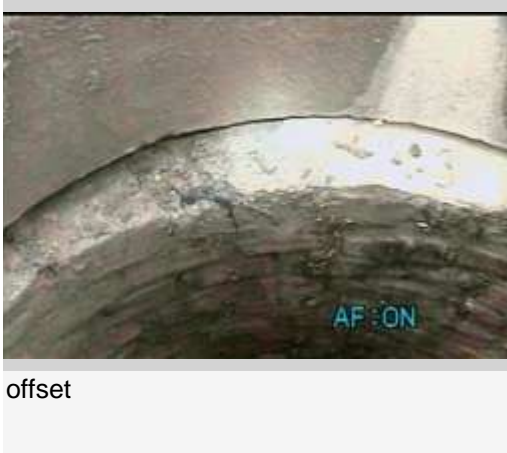

offset

## Manhole Inspection Summary

Manhole # S47I\_\_050MH

Printed On: 2/12/2009

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 OClock

12 O'Clock Outflow



Pipe Height: **0** (in.) Direct  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **10.25** (ft.) Flow Characteristics: **Fast**  
Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 OClock

3 O'Clock Inflow

Drop In @ 3 OClock



Pipe Height: **0** (in.) Direct  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **8.95** (ft.) Flow Characteristics: **Fast**  
Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Unknown**



Drop: **Outside Direct**  
Angled: Reading: **0.00** (ft.)  
Inv Depth: **9.25** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S47I\_\_050MH

Printed On: 2/12/2009

Page 4 of 4

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.41** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.33** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection